

Mould Abatement G U I D E L I N E S



We are pleased to introduce the enclosed publication of the **Environmental Abatement Council of Ontario's (EACO)** Mould Abatement Guidelines.

These guidelines have been developed by the Mould Abatement Sub-Committee of **EACO** and we wish to thank them for their work. The Committee has ensured that these guidelines are practical, clear and, of particular importance, are consistent with the more general "Mould Guidelines for the Canadian Construction Industry", published by the Canadian Construction Association (available from www.cca-acc.com).

This guideline is representative of the work undertaken by **EACO** as the voice of the environmental abatement industry in Ontario. **EACO** has also produced a comprehensive study of worker asbestos exposure in Ontario Construction for the Ontario Ministry of Labour (MOL). Both of these documents are being considered by the MOL for adoption as guidelines, codes of practice or for inclusion in new regulations under the Occupational Health and Safety Act. **EACO** plays an important role in providing input to the MOL on these matters.

We encourage all persons or companies involved in environmental abatement, whether as a contractor, consultant, general contractor or representative of a building owner, school board or building operator, to become involved in the industry through membership in **EACO**.

Information on **EACO** membership and additional or electronic copies of the **EACO** Mould Abatement Guidelines are available from Ms. Mary Thorburn, **EACO** Secretary, at 416-499-4000, Ext. 114 or by email at mthorburn@tcaconnect.com.

We trust you will find this document of value. If you have any comments, please address them to the **EACO** offices at –

Environmental Abatement Council of Ontario 70 Leek Cres. Richmond Hill ON L4B 1H1



Foreword

This guideline has been prepared to assist building owners, constructors, contractors, subcontractors and workers who have duties under the Occupational Health and Safety Act and its Regulations to safely perform work activities involving Mould (Microbial) abatement and remediation. The guideline promotes safe work practices, the use of personal protective equipment, worker awareness and training and is based on a thorough review of the available guidance materials available to March 2009 and professional experience of the abatement industry in Ontario.

We believe that this guideline will not only help employers fulfill their responsibilities and due diligence under the Occupational Health and Safety Act but will also assist them to better address the challenges involved with proper assessment and remediation of Mould (Microbial) contamination in buildings.

Disclaimer

EACO disclaims any liability or risk resulting from the use of the work practices and recommendations discussed in the guideline. It is the user's responsibility to ensure that these apply to the specific workplaces and to ensure compliance with all other applicable federal, provincial and local acts and regulations.

Table of Contents

1.0	Section A:	General Points and Limitations
2.0	Section B:	General Precautions Applicable To All Levels of Mould Abatement Work
3.0	Section C:	Precautions for Level 1, 2 and 3 Mould Abatement
Appendix A		Typical Level 3 Mould Decontamination Facility Lay-Out
Appendix B		Procedures for Clean-Up of Bird and Bat Droppings
Appendix C		Additional Hazards with Abrasive Blasting In Mould Abatement
Appendix D		Definitions

SECTION A: GENERAL POINTS AND LIMITATIONS

- Three levels of work practice are given for removal of Small, Medium and Large-scale Mould growth, depending on the extent of material supporting Mould growth present. The thresholds between Small and Medium project areas (10 ft²) and between Medium and Large project areas (100 ft²) are a guideline only and are subject to professional judgment. EACO recommends that the enumeration of Mould growth be based on an approximation of the extent of visible growth (total affected area of building material), including the estimated extent of any hidden Mould.
- 2. These procedures do not address the identification or control of the cause(s) of the Mould growth being abated by these procedures. The project authority is cautioned to ensure that the underlying cause(s) of the Mould growth is investigated and remedied prior to completing the Abatement process to reduce the potential for Mould regrowth.
- 3. These procedures do not address the potential for fungal infections that may be acquired by Susceptible Occupants in hospitals or other health care settings if Mouldy materials are disturbed without appropriate precautions. Refer to "Construction-related Nosocomial Infections in Patients in Health Care Facilities Decreasing the Risk of Aspergillus, Legionella and Other Infections", July 2001, Canada Communicable Disease Report, Health Canada and CSA Standard Z317.13-07, Infection Control During Construction or Renovation of Health Care Facilities.
- 4. These procedures do not address the potential presence of Designated Substances (asbestos, lead, etc.) or other hazardous materials in a mould remediation work area. The project authority is cautioned that designated substances are regulated in Ontario under the Occupational Health & Safety Act. In addition, Ontario Regulation 278/05, Regulation Respecting Asbestos on Construction Projects and in Buildings and Repair Operations (O. Reg. 278/05) outlines specific procedures for the handling and disturbance of asbestos-containing materials (ACM). Typical ACMs that may be disturbed as part of a mould remediation project include drywall joint filling compound, ceiling tiles, pipe and duct insulation and vinyl flooring.
- 5. These procedures are not intended to address Biohazards, other than Mould, potentially present in a project area as a result of contamination with sewage waste, river floods or other water with high levels of Microbial contamination. The reader is referred to the guidance of the Institute of Inspection, Cleaning and Restoration Certification S500 Standard, "Standard and Reference Guide for Professional Water Damage Restoration." Additional precautions might apply.
- 6. These guidelines are not meant to respond to the development of minor areas of superficial mould growth in households due to water absorption or condensation on the occupied side of finishes, often referred to as lifestyle mould growth. Examples include spotty mould growth on grout in bathrooms or on cold window frames under winter conditions. Such areas of minor surface mould growth are generally limited in

area and can usually be addressed with improved ventilation and/or moisture control, and standard house cleaning methods. However, if there are large areas of surface condensation or indications of sub-surface moisture sources, the area should be inspected for the possibility of hidden water damage or mould growth.

SECTION B: GENERAL PRECAUTIONS APPLICABLE TO ALL LEVELS OF MOULD ABATEMENT WORK

1. Protection of Occupants

1.1 The project authority should consider whether occupants should be removed from areas adjacent to the work area. The removal of occupants from spaces adjacent to the work area is not necessary in all cases but should be considered in the presence of Susceptible Occupants including but not limited to infants less than 12 months old, persons having undergone recent surgery, the elderly, immune suppressed people, or people with chronic inflammatory lung diseases.

2. Worker Training and Medical Pre-screening

- 2.1 Mould abatement workers shall be trained in the hazards of Mould Abatement and in the procedures to be followed. Training at a minimum shall include classroom and site instruction. Minimum training topics shall include: hazards of mould abatement; use and limitations of personal protective equipment such as respirators and gloves; proper abatement practices including site isolation, removal techniques, proper clean-up and decontamination procedures. General health and safety training should also be provided to workers, as required by the Occupational Health & Safety Act and regulations for construction sites, and waste handling and disposal regulations.
- 2.2 Workers must be fit to work with potential Mould exposure. Workers with a history of significant allergic disease (asthma, hay fever, hives, etc.) or with a potential immuno-compromised status (persons with an immune system disease, taking immune system suppression medication, etc.) should consult with an experienced physician to determine whether Mould removal activities, and the associated potential for exposure to pathogenic materials, would present an unacceptable health risk.
- 2.3 Mould Abatement workers who may encounter a risk of infectious disease from unsanitary water sources (sewage, river floods, etc.) should consult with an experienced physician regarding vaccinations to reduce the risk of infectious disease through available immunizations, particularly Hepatitis A and B, tetanus and polio.

3. Respiratory Protection

3.1 The respiratory protection in these procedures has been established for protection against fungal particulate material, for which a Respirator with a NIOSH-approved particulate filter will be adequate. Another type of Respirator may be required if the Mould Abatement will employ a Disinfectant with a volatile hazardous ingredient (i.e.

household chlorine bleach). Consult MSDS data for specific respiratory protection in relation to specific cleaning products.

- 3.2 Respirators shall be NIOSH approved.
- 3.3 Workers should complete Respirator pre-screening as detailed in CSA Standard Z94.4-02, Selection, Care and Use of Respirators (Appendix E Figure E1) and, if required, consult with an experienced physician to determine if a Respirator can be used without serious difficulty.
- 3.4 Respirator wearers shall be Fit-tested for each type of Respirator, prior to use, following CSA Standard Z94.4-02, Selection, Care and Use of Respirators.
- 3.5 Follow CSA Standard Z180.1 as amended, for testing of breathing air quality for supplied air respiratory protection required for dry ice abrasive blasting (see Appendix C).
- 3.6 Clean and maintain the Respirator and battery pack (where applicable) in accordance with manufacturer's recommendations.
- 3.7 No facial hair or spectacle side arms, which affect the seal of the Respirator to the skin, are allowed.
- 3.8 Dispose of filters daily due to the potential growth of Mould spores on damp filter media.
- 3.9 Due to the nature and working conditions of Mould Abatement, Filtering Facepiece Respirators shall not be utilized for Level 2 or Level 3 Abatement projects.

4. Personal Protection and Hygiene

- 4.1 Workers shall wear dust-impermeable gloves appropriate for the work underway and water-impermeable gloves for application of detergent and/or Disinfectant. Refer to the MSDS for the detergent and/or Disinfectant for glove selection.
- 4.2 Wash face and hands after work at the Abatement project each time after exiting the Abatement work area.
- 4.3 For all levels of work, eating, drinking or smoking is prohibited in the work area.

5. Cleaning

- 5.1 Pre-clean any items that will be retained, whether removed from the work area or covered and left in the work area. Use appropriate and effective cleaning methods.
- 5.2 After bulk removal, clean the surrounding areas with a HEPA vacuum. No other type of vacuum can be used. If a HEPA vacuum is not available, wet wiping may be adequate for Level 1 work.
- 5.3 Do not dry sweep or dry whisk. Use power tools only if fitted with effective HEPAfiltered dust collection.

- 5.4 Wipe all non-Porous surfaces within the removal area with a detergent solution. Rinse with clear water as required.
- 5.5 As an option, a Disinfectant solution can be used in place of, or in addition to a detergent. Apply the Disinfectant as specified by the manufacturer, maintaining the surfaces wet for the prescribed period. Generally, surfaces to be disinfected must be cleaned of all dust and loose organic material prior to application of the Disinfectant. A Disinfectant is required where the work area has been contaminated with a significant pathogenic hazard (i.e. sewage floods).
- 5.6 The project authority should consider the use of a Disinfectant in hospital or health care settings, or in other settings where the project authority believes occupants to be significantly immuno-compromised. Refer to the Health Canada and CSA guidelines for prevention of fungal infections in health care settings, given above.
- 5.7 Use only disinfectants with current Health Canada DIN registration. Apply the disinfectant according to the DIN label, observing requirements for mixing, storage time, worker safety, pre-cleaning, contact time, and any requirements for rinsing.
- 5.8 These cleaning requirements apply to all exposed surfaces within the work area. The project authority will determine if soft goods and Porous materials can be adequately cleaned or must be disposed of.
- 5.9 Clean all equipment used in the Abatement work area by HEPA vacuuming or wet wiping. Equipment that cannot be readily cleaned shall be HEPA vacuumed and sealed in 6 mil polyethylene bags before removal from the work area.

6. Post Abatement Cleanup

- 6.1 Remove Polyethylene sheeting used during abatement by carefully rolling towards the centre of the work area. Clean any visible dust and debris using a HEPA vacuum.
- 6.2 Clean all tools, supplies and equipment in the work area using a HEPA vacuum and by wet wiping. Equipment that cannot be readily cleaned (i.e. vacuum hose, wire brushes, etc.) shall be HEPA vacuumed and sealed in 6 mil polyethylene bags or suitable sealed containers before removal from the work area.
- 6.3 Seal the intake and exhaust of HEPA Filtered Exhaust Fans (negative air machines) and clean the cabinet by wet wiping, before removal from the work area.
- 6.4 Leave the work area and surrounding areas dry and visibly free of dust and debris.

7. Waste Disposal

7.1 Remove all waste as contaminated material, including but not limited to building debris, disposable coveralls, Respirator filters and/or cartridges, and plastic sheeting. All waste should be immediately double-bagged into two 6-mil polyethylene bags, each individually sealed. If the material cannot be bagged, wrap in 2 layers of 6 mil Polyethylene Sheeting and seal with tape.

7.2 Transport and dispose of the waste material in compliance with local, provincial and federal regulations, including the Ontario Environmental Protection Act and any other regulations, which may apply to the Mould or the substrate on which the Mould was located

8. Post-Abatement Drying

8.1 By the completion of the mould abatement, ensure the cause of the mould growth has been identified and an action plan initiated to prevent further mould growth. Also, at completion of mould abatement check that the remaining finishes (i.e. concrete, wood framing, sub-floors) have been adequately dried so that mould growth will not reoccur when new finishes are installed. The work area may require further drying efforts before re-construction can commence.

SECTION C: PRECAUTIONS FOR LEVELS 1, 2 AND 3 MOULD ABATEMENT

- Level 1: Small Isolated Areas, Less than 10 ft² (1 m²) of Building Materials or Clean-up of Less than 10 ft² (1 m²) of Mould Growth in HVAC Systems in Non-occupied Areas.
- 9.1 This section gives instructions for performing Mould Abatement specifically for small-scale projects. This work practice is suitable for the abatement of under about 10 square feet of mould growth on building materials or finishes or the abatement of the same extent of mould growth within HVAC equipment in non-occupied areas such as mechanical rooms. Abatement of HVAC equipment in occupied locations shall be performed following a minimum of Level 2 procedures (contained mould abatement). Comply with all of the items of Section B, General Precautions (protection of occupants, worker training and medical pre-screening, respiratory protection, personal protection and hygiene, cleaning, and waste disposal) while performing this work.
- 9.2 The worker shall wear a half face piece air-purifying Respirator fitted with replaceable filters (N95 minimum) or a Filtering Facepiece Respirator (N95 minimum) plus appropriate gloves.
- 9.3 Workers may wear full-body dust-impervious coveralls with attached hoods. Secure the coveralls tight at the ankles and wrists.
- 9.4 Turn off HVAC systems and seal over any diffusers immediately adjacent to the work area.
- 9.5 Where possible, place a drop sheet below the Mouldy materials.
- 9.6 Dust Suppression methods should be used where possible, prior to disturbance of the Mouldy materials. Tape a section of plastic sheeting or duct tape over the Mouldy material, or if this is not feasible, lightly mist the Mouldy material with water.

- 9.7 Remove any Porous substrate materials (ceiling tiles, drywall, etc.) to a point beyond the immediate areas of visible contamination, for a minimum distance of 30 cm in all directions
- 9.8 Clean the work area and dispose of the waste.
- Level 2: Medium areas, 10-100 ft² (1-10 m²) or less than 10 ft² (1 m²) in HVAC Systems in Occupied Areas
- 10.1 This section gives instructions for performing Mould Abatement specifically for medium scale projects, or the abatement of less than 10 square feet of mould growth in HVAC equipment in occupied areas. Comply with all of the items of Section B, General Precautions (protection of occupants, worker training and medical prescreening, Respiratory protection, personal protection and hygiene, cleaning, and waste disposal) while performing this work.
- 10.2 Consult with a qualified Health and Safety Professional with experience performing Microbial investigations and remediation, prior to remediation work, to provide Quality Assurance for the project and monitoring of compliance with these guidelines.
- 10.3 A competent supervisor must be present during all Contaminated Work.
- 10.4 The worker shall wear gloves appropriate for the work being done and full-body dustimpervious coveralls with attached hood. Secure the coveralls tight at the ankles and wrists.
- 10.5 The worker shall wear an elastomeric half face piece air-purifying Respirator fitted with 100 Series Filter cartridges with safety glasses.
- 10.6 Workers shall wear disposable boot covers or separate work boots that can be effectively HEPA vacuumed or wiped clean prior to removal from the work area.
- 10.7 Cover and seal all ductwork and diffusers in the work area. Isolate the HVAC systems.
- 10.8 The Abatement area must be secured and access restricted. Isolate the work area with an enclosure constructed of fibre-reinforced Polyethylene Sheeting or 6 mil Polyethylene Sheeting, taped and supported as required. Provide a temporary roof where an existing ceiling does not complete the temporary enclosure. The Project authority may require a single chamber decontamination/change room.
- 10.9 A Competent Supervisor or project authority must inspect the work area for defects in the enclosure, barriers and change room, at the beginning of every shift and at the end of every shift. Records of the inspections should be generated and maintained.
- 10.10 Install signs warning of the exposure hazard. Suggested wording: CAUTION, MOULD EXPOSURE, WEAR ASSIGNED PROTECTIVE EQUIPMENT, AUTHORIZED PERSONNEL ONLY.
- 10.11 Provide continuous Negative Pressure within the enclosure by drawing air from the work area and exhausting it out of the enclosure, either by use of a HEPA vacuum or a

portable HEPA-filtered exhaust fan. Provide a minimum Negative Pressure of 5 Pascals (0.02 inches of water column) and at least 4 air changes per hour. Discharge the filtered air outside the building and away from persons wherever possible, and if this is not possible, consider on-site leak testing of the HEPA filtered equipment. Negative Pressure must be maintained until the completion of all Contaminated Work.

- 10.12 Remove any Porous substrate materials (ceiling tiles, drywall, etc.) to a point beyond the immediate areas of visible contamination, for a minimum distance of 30 cm in all directions.
- 10.13 Clean the work area and dispose of the waste.
- 10.14 Before exiting the work area, workers shall fully wipe or vacuum clean all footwear, coveralls and other personal protective equipment and remove and dispose of protective equipment not for re-use. Workers shall then complete personal cleaning as in Section B, General Precautions.
- 11. Level 3: Large Areas, More than 100 ft² (10 m²), or more than 10 ft² (1 m²) in HVAC Systems
- 11.1 The following work procedures describe the general set-up, conduct and safety measures for Level 3 Mould Abatement. Each project should be conducted following a site-specific work plan or specification developed by a Health and Safety Professional.
- 11.2 This section gives instructions for performing Mould Abatement specifically for large-scale projects. Comply with all of the items of Section B, General Precautions (protection of occupants, worker training and medical pre-screening, Respiratory protection, personal protection and hygiene, cleaning, and waste disposal) while performing this work.

Quality Assurance

11.3 Consult with a qualified Health and Safety Professional with experience performing Microbial investigations and remediation, prior to remediation work, to develop a site specific work plan or specification and Quality Assurance services for the project and monitoring of compliance with these guidelines.

Worker Protection

- 11.4 The worker shall wear a tight-fitting full face piece Powered Air Purifying Respirator with high efficiency particulate filters or a non-powered full face piece air purifying Respirator fitted with 100 Series Filters. Refer to Appendix C for respiratory protection for dry ice abrasive blasting.
- 11.5 The worker shall wear gloves appropriate for the work being done and full-body dustimpervious coveralls with attached hood. Secure the coveralls tight at the ankles and wrists.

- 11.6 Workers shall wear disposable boot covers or separate work boots that can be effectively HEPA vacuumed or wiped clean prior to removal from the work area.
- 11.7 A Competent Supervisor must be present during all Contaminated Work.

Site Isolation

- 11.8 Seal all ductwork and diffusers in the work area. Isolate the HVAC systems.
- 11.9 Isolate the work area from adjacent spaces using temporary hoarding, tape and Polyethylene Sheeting, etc.
- 11.10 Install signs warning of the exposure hazard. Suggested wording: CAUTION, MOULD EXPOSURE, WEAR ASSIGNED PROTECTIVE EQUIPMENT, AUTHORIZED PERSONNEL ONLY
- 11.11 Provide continuous Negative Pressure within the enclosure, through use of portable HEPA-Filtered Exhaust Fans. Provide a minimum Negative Pressure of 5 Pascals (0.02 inches of water column) and at least 4 air changes per hour. Note that higher levels of negative air pressure may be required to maintain site isolation. Discharge the filtered air outside the building and away from persons wherever possible, and if this is not possible, perform on-site leak testing of the HEPA filtered fan. Negative Pressure must be maintained until the completion of all Contaminated Work.
- 11.12 Negative Pressure within the enclosure shall be continuously measured and recorded.
- 11.13 A Competent Supervisor must inspect the work area for defects in the enclosure, barriers and change room, at the beginning of every shift, at the end of every shift where there is no shift beginning immediately following the shift that is ending, and at least once per day on days where there are no shifts. Records of the inspections should be generated and maintained.

Worker and Waste Decontamination Facilities

- 11.14 Provide a Worker Decontamination Facility, to include a clean change room and a dirty change room. Install flap doors at each opening into and within the decontamination facility. Provide a wash station consisting of at least a basin, fresh water, soap and toweling, in the clean change room. A shower for worker comfort may be provided, but is optional. Refer to Appendix A for a diagram of a typical Decontamination Facility.
- 11.15 When going into the Contaminated Work area the worker will don clean coveralls and a Respirator in the clean change room.
- 11.16 Prior to exiting the Contaminated Work Area, the worker will use a HEPA vacuum in the work area to remove gross contamination from coveralls and boot covers (or separate dirty work boots).

- 11.17 The worker will then enter the dirty change room where the dirty coveralls and boot covers are removed (to be used only once). Work boots used without boot covers will also be removed and stored in the dirty change room.
- 11.18 The worker then proceeds to the clean change room to complete clean up. The wash station is to be used by each worker on leaving the work area to clean face and hands.
- 11.19 A separate Waste Decontamination Facility, consisting of a double bagging room and a waste transfer room should be provided where large volumes of waste will be removed. Seal the waste into bags (or Polyethylene Sheeting sealed with tape) in the Contaminated Work area, and wipe the exterior of the bags or other containers. Transfer the waste to the double bagging room and place a second bag around bagged waste. Seal the second bag. Transfer the double-bagged waste into the waste transfer room for removal by workers entering from the outside of the decontamination facilities

Removal, Salvage and Cleaning

- 11.20 Remove any Porous substrate materials (ceiling tiles, drywall, etc.) to a point beyond the immediate areas of visible contamination, for a minimum distance of 30 cm in all directions
- 11.21 Clean the work area and dispose of the waste. Clean tools and equipment such as vacuums, negative air units or any other items that were exposed during abatement.

Clearance Inspection and Monitoring

11.22 The project authority or representative should inspect the Level 3 work area for acceptable completion, by a combination of careful visual inspection and possibly testing. A site will be considered acceptable and clean when a thorough visual inspection shows an acceptable state of cleanliness. In addition, Clearance Tests (air samples, swabs, tape-lifts or vacuumed dust samples) should be taken to indicate the work area is no longer impacted by the Mould contamination and removal process.


Generally, clearance air samples collected within the work area will be compared to reference samples taken in adjacent areas from where the work area make-up air is being drawn, another suitable location, or to outdoor air samples. An acceptable condition is indicated when:

- Concentrations of airborne fungal particles in the work area are not significantly elevated when compared to concentrations in the reference area;
- 2. The types of fungal particulate present in the work area do not significantly differ from those present in the reference area.

The clearance samples may also be compared to any similar measurements taken in the work area prior to the remediation work. Surface samples should show minimal or

no Mould growth remaining at completion. Interpretations of sample results are subject to the professional judgement of a health and safety professional with experience performing microbial investigation and remediation.

Appendix A

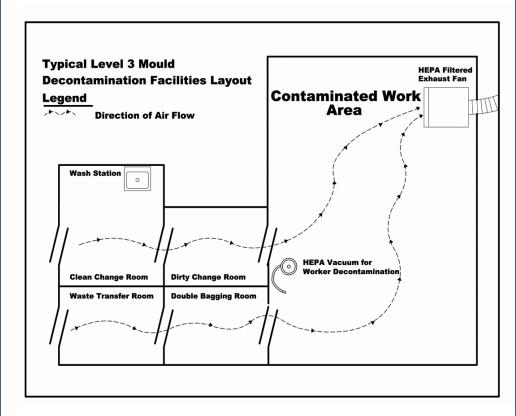

Appendix B: Procedures for Cleanup of Bird and Bat Droppings

Workers removing accumulations of bird or bat droppings are at risk of exposure to airborne fungal spores (and other Microbial hazards) likely to be released when this material is disturbed. Bird and bat droppings should be presumed to be contaminated with the fungi Histoplasma capsulatum, Cryptococcus neoformans, and other infectious hazards. The spores of some of these organisms can remain infectious for decades after their growth in the Guano has ceased. Many of these microorganisms are known to cause Respiratory infections in workers exposed during construction or maintenance disturbance.

NOTE: Although a Disinfectant will be applied during this work, the treated excrement may still contain viable organisms and use of personal protective equipment should continue until the site is well cleaned.

Personal Protection

All work will require the following personal protective equipment:

- Rubber boots.
- Either disposable gloves taped to coveralls and worn under work gloves, or heavy rubber or nitrile work gloves, taped to coveralls.
- Disposable coveralls, taped to gloves and to boots.
- Minimum of a full-face piece Respirator fitted with appropriate cartridge
 filters. As a minimum, P100 filters are required for protection against
 airborne particles. Depending on the Disinfectant used, the cartridge may
 have to include protection against vapours or gases. A Powered Air
 Purifying Respirator (PAPR) fitted with an appropriate cartridge filter may
 also be used, and will provide more comfort for the worker.

Disinfectant

Use only disinfectants with current Health Canada DIN registration. Apply the disinfectant according to the DIN label, observing requirements for mixing, storage time, worker safety, pre-cleaning, contact time, and any requirements for rinsing.

Work Practices

- Perform an initial shoveling and dry HEPA vacuum removal of as much of the residue as possible, if the residue is soft or loose.
- Following a HEPA vacuuming, apply a Disinfectant solution to all areas with visible residue. Apply with a garden sprayer set for droplet as opposed to mist

spraying. Lightly brush to ensure uniform wetting and contact through to the underlying surface. Apply additional Disinfectant as necessary to maintain the area wet for the contact time specified by the Disinfectant manufacturer. Leave the material wet overnight where practical to do so.

- Clean the area of residue with suitable tools and HEPA vacuuming. Lightly mist with water to reduce dust formation.
- 4. After surfaces have been cleaned of residue to the extent possible, apply a second application of the Disinfectant and maintain wet contact time for the period recommended by the manufacturer. If the surface cannot be left with a residue, rinse and wipe with clear water.

Waste Collection and Disposal

Collect all waste into 6 mil disposal bags and immediately seal. Wipe the bag with the Disinfectant solution and place into a second bag. Ensure proper notification and compliance with all applicable local, provincial and federal regulations including the Ontario Environmental Protection Act.

Appendix C: Additional Hazards with Abrasive Blasting in Mould Abatement

Abrasive blasting techniques, using media such as soda, dry-ice or sand, are effective methods for the removal of mould growth from contaminated building materials. However, it must be recognized that additional hazards to workers and building occupants might exist when utilizing such methods. The primary hazards and additional precautions recommended for abrasive blasting of mould growth are summarized below.

- The aggressive disturbance of mould growth through blasting will result in much higher airborne mould concentrations than manual removal methods.
- Abrasive blasting will release significant amounts of carbon dioxide (CO₂) into the
 work area which may result in an overexposure to carbon dioxide in enclosed work
 areas
- The compressed air used to deliver the blasting media will reduce the negative pressure in the containment. Even smaller blasting equipment delivers 2000 cfm or more into the containment. This air supply will offset the negative pressure created by negative air ventilation equipment.
- The pressure applied by the blasting equipment can transport or drive mould debris
 through various substrates, building elements, and assembles (such as floor board
 seams, roof and wall sheathing seams, service penetrations, expansion joints, etc.) to
 uncontained or occupied areas where it might impair air quality or expose other
 workers, building occupants or the public.

Based on these hazards, additional precautions should be included when conducting abrasive blasting operations. The following precautions are in addition to other measures prescribed earlier in this guideline.

Containment

- 1. Regardless of the size of the area being abated or the density of mould growth, Level 3 precautions should be used for all blasting activities.
- 2. Ensure the substrate, assembly, etc. being blasted will not permit the penetration of blast media, dust or mould. If the media is likely to permit the transport of blast media, dust or mould then erect appropriate secondary containment.
- 3. Provide adequate negative pressure ventilation during abrasive blasting. The ventilation must take into consideration the supply of air into the work area by the compressed air delivery of the abrasive media. This will require more ventilation than 4 air changes per hour.

4. Continually monitor the workplace atmosphere for oxygen content and carbon dioxide when using abrasive blasting methods.

Blast Media and Substrate Dust

- 5. Silica containing blast media should not be used wherever possible due to the high toxicity of fine silica dust. This is of particular importance in occupied buildings.
- Ensure that adequate precautions are taken to control the hazards of the dust generated from the surfaces being impacted, such as lead based paint, silica containing substrate or asbestos containing materials.

Personal Protection

- 7. Regardless of the size of the area being abated or the density of mould growth, the minimum respiratory protection shall be a full face piece air purifying respirator with P100 filters.
- Wear supplied air respiratory protection for abrasive blasting with dry ice. Monitor
 carbon dioxide concentrations on an ongoing basis to determine the requirement for
 and adequacy of supplied air respiratory protection.
- The addition of a worker decontamination shower should be considered, but is optional.

Appendix D – Definitions

Abatement The process of returning a building or part thereof, from a condition of Biohazard, to background concentrations of biological agents and

products, typical of buildings not affected by Mould contamination.

Biohazard The presence of (a) biologically derived aerosols, gases, or vapours of a

kind and concentration likely to cause disease or predispose persons to adverse health effects, or (b) indoor biological growth and remnants of growth that may become airborne and to which people may be exposed.

Canister or Cartridge A container with a filter, sorbent, or catalyst, or combination of these

items, which removes specific contaminants from the air passed

through the container.

Clearance Tests Environmental tests (i.e. air samples, tape lifts, swabs) taken after

Mould Abatement has been completed as a Quality Assurance measure.

Competent Person or Supervisor A person who is qualified because of knowledge, training and

experience to organize the performance of Mould Abatement, is familiar with Mould Abatement procedures, and has knowledge of the hazards of Mould and other dangers in the Abatement work area.

Contaminated Work The portion of the Abatement project during which active disturbance.

handling or cleanup of contaminated materials is occurring.

Cryptococcus neoformans Pathogenic yeast growing in accumulated bird (usually pigeon) or bat

Guano and posing a risk of cryptococcosis infections in heavily

exposed or immuno-compromised individuals.

Disinfectant Substance used to reduce the number of micro-organisms such as

Moulds, bacteria or viruses to below the level necessary to cause infection. Some common Disinfectants include sodium hypochlorite,

quaternary ammonium compounds, and hydrogen peroxide.

DIN Drug Identification Number. Registration number given by Health

Canada for approval of disinfectants. Specifies the organisms against which the disinfectant is effective, and requirements for mixing,

storage, application, and rinsing, if required.

Designated Substance Hazardous materials (asbestos, lead, silica, mercury and others)

designated by the Ontario Ministry of Labour for specific regulation under the Occupational Health and Safety Act. Property owners must notify contractors bidding on projects of the presence of Designated states. In addition to a regulation on asbestos, the Ontario Ministry of Labour has issued guidelines for the potential exposure from silica, lead, mercury and isocyanates on construction projects.

Dust Suppression Measures taken to reduce the release of spores and other Mould-

derived particulate matter during Mould Abatement.

Filtering Facepiece Particulate-filtering Respirator where the facepiece is also the filter.

Fit-test A qualitative or quantitative method to evaluate the fit of a specific

make, model and size of Respirator on an individual.

Guano Bird or bat dung, considered a risk for infection by Moulds or other

micro-organisms.

HEPA Filtered Exhaust Fan Portable exhaust fan in sealed cabinet equipped with HEPA filtration

used to exhaust filtered air out of an enclosed Mould Abatement work area for the purpose of establishing and maintaining a Negative Pressure in the Mould Abatement work area with respect to surrounding areas, and also to provide general ventilation of the

Abatement area.

Health and Safety Professional An individual qualified by knowledge, skills, education, training and

experience to perform assessments of Mould contamination, collect and interpret environmental tests, develop recommendations for Abatement

work and provide inspection and Quality Assurance services.

HEPA High Efficiency Particulate Air filter capable of trapping and retaining

particles greater than or equal to 0.3 micrometers in diameter, at a

minimum efficiency of 99.97%.

and a risk for human infections during remediation work, renovation

and demolition.

HVAC Heating, ventilating and air conditioning (equipment).

Mould Normally refers to fungi with filamentous growth form, often giving

rise to "fuzzy", cottony, wooly or powdery textured colonies. Moulds produce spores that are poorly visible or not visible at all to the naked

eye and that in many species are specialized to become airborne.

Microbial Referring to any of Mould, bacteria, viruses or other micro-organisms.

MSDS Material Safety Data Sheet, required by Workplace Hazardous

Materials Information System (WHMIS) legislation, and giving information on hazardous materials, including properties, hazards, first-

aid, emergency response, and personal protection.

N95 A Respirator particulate filter, 95% efficient at stopping a 0.3

micrometer aerosol, and not resistant to oil, a classification of

particulate filters set by NIOSH.

Negative Pressure A reduced pressure established within a Mould Abatement enclosure by

extracting air directly from Abatement area, and discharging this air outside the work area. The discharged air must be HEPA filtered, the exhaust unit should be leak-checked and preferably the air is

discharged outside the building.

NIOSH National Institute for Occupational Safety and Health, part of the U.S.

Centers for Disease Control and Prevention.

100 Series Filter Any Respirator particulate filter, 99.97% efficient at stopping a 0.3

micrometer aerosol. A classification of particulate filters set by NIOSH.

Polyethylene Sheeting Polyethylene Sheeting or rip-proof Polyethylene Sheeting with tape

along edges, around penetrating objects, over cuts and tears, and elsewhere as required providing a continuous membrane to protect underlying surfaces from damage, and to prevent escape of airborne

contamination through sheeting into occupied areas.

Porous Permeable to Mould growth, allowing growth to extend significantly

below the immediate surface.

P100 A Respirator particulate filter, 99.97% efficient at stopping a 0.3

micrometer aerosol, and resistant to oil droplets, a classification of

particulate filters set by NIOSH.

Quality Assurance Measures of inspection, testing and documentation to promote

confidence that the Abatement process will meet the desired goals.

Respirator A device to protect the user from inhaling a hazardous atmosphere.

Susceptible Occupants Persons with elevated risks of reacting to mould exposure, usually due

to allergic pre-disposition or compromised immune state. Examples include but are not limited to infants (less than 12 months old), persons recovering from recent surgery, or people with immune suppression, asthma, severe allergies, sinusitis or other chronic inflammatory lung

diseases.

Waste Decontamination Facility A series of two rooms (Double-bagging and Transfer) constructed in

such a way as to allow waste and equipment to enter and leave a Mould Abatement area without spreading contaminants beyond the Abatement

area.

Worker Decontamination Facility A series of two rooms (Clean and Dirty) constructed in such a way as

to allow persons to enter and leave a Mould Abatement area without spreading the contaminants beyond the Abatement area.



Tel: 416.499.4000 • Fax: 416.499.8752 2nd Edition - 2010